PROBLEM SYMPTOMS TABLE

Symptom	Suspect Area	See page
Immobiliser is not set. (Engine starts with key codes other than the registered key code.)	1. Engine and ECT ECU	IN-30
Engine does not start.	 Key Wire harness Transponder key coil Amplifier Engine and ECT ECU 	*1 IN-30 ★ BE-253 IN-30
Security indicator is always ON.	 Security indicator Wire harness Engine and ECT ECU 	*2 IN-30 IN-30
Security indicator is always ON. (Although code has been registered in the automatic registration mode, indicator is not OFF.)	 Wire harness Transponder key coil Amplifier Engine and ECT ECU 	IN–30 ★ BE–253 IN–30
Security indicator is OFF. (When DTC of immobiliser is output)	1. Wire harness 2 Transponder key coil 3. Amplifier 4. Engine and ECT ECU	IN-30 ★ BE-253 IN-30
Security indicator is OFF. (When DTC of immobiliser is not output)	1. Wire harness 2. Engine and ECT ECU	IN-30 IN-30
Security indicator is abnormally blinking.	1. Wire harness 2. Engine and ECT ECU	IN-30 IN-30

*1 : Check that the key which did not start the engine has been registered and that it is possible to start with other already registered key.

*2 : Finish the automatic registration mode because the mode might still remain.

★: LEXUS GS300 Repair Manual Pub. No. RM588E

DI1AP-24