

executive silver / 2007 LS460

Service History for VIN:

Sort By:

SERVICE TYPE	DATE	SERVICE PROVIDER MILEAGE	REPAIR #	DESCRIPTION
Dealer Reported	09/23/2015	72944		MISC CUSTOMER STATES TRUNK DOESN'T CLOSE WHEN PRESSING TRUNK BUTTON AT TIMES, CHECK AND ADVISE. - TRUNK CLOSE SWITCH INTERMITENT OPEN CIRCUIT. - REPLACE TRUNCK CLOSER SWITCH COMPLETED COSTCO EXT WARRANTY AUTH#€ \$139.81+TAX
Dealer Reported	09/23/2015	72944		OTHERS CUSTOMER STATES VEH HAS VSC, ABS, TRACK LIGHT AND PCS LIGHT ON, CHECK AND ADVISE. - FOUND RIGHT REAR WHEEL SPEED SENSOR MALFUNCTION, WHEEL BEARING TONE RING COMING OFF DAMAGING SENSOR. - REPALCE WHEEL SPEED SENSOR AND WHEEL HUB ASSEMBLY COMPLETED COSTCO EXT WARRANTY AUTH# . \$826.97
Dealer Reported	03/13/2015	69703		MISC CUST STATES DRIVER SIDE DOOR LOCK INOP CUSTOMER HAS EXT WARR 1 - 800 - 364 - 4714 CONTRACT - FOUND FRONT DRIVER SIDE DOOR LOCK CLOSER INTERNAL FAILURE - NECESSARY TO REPLACE FRONT DRIVER SIDE DOOR LOCK CLOSER COSTCO WARRANTY AUTH# \$951.02
Dealer Reported	03/13/2015	69703		FUEL SENSOR CAMPAIGN SAFETY CAMPAIGN ELF (E2F) - THE FUEL DELIVERY PIPES COULD HAVE BEEN PRODUCED WITH PARTICLES OF EXCESS PLATING MATERIAL ON THE GASKET SEATING SURFACE WHERE THE FUEL PRESSURE SENSOR IS INSTALLED. THESE PARTICLES MAY DEGRADE THE SEATING EFFECTIVENESS OF THE GASKET. - REPAIRED THE FUEL PRESSURE SENSOR SEALING SURFACE AND REPLACED THE GASKET AT NO CHARGE AS PER SAFTEY RECALL
Dealer Reported	03/13/2015	69703		HDLAMP RESTORATION PERFORM HEADLAMP RESTORATION. \$89.95+TAX - HEADLAMP DETERIORATION. - NO CHARGE
Dealer Reported	11/26/2014	67863		INSPECT BATTERY CHARGE LEVEL CUST STATES ENGINE NO CRANK - FOUND BATTERY DEAD CELL - NECESSARY TO REPLACE BATTERY PARTS WARRANTY
Dealer Reported	11/26/2014	67863		TIRE LIGHT INSP. CUSTOMER STATES TIRE LIGHT INDICATOR IS ON. - FOUND LEFT FRONT TPMS SENSOR INTERNAL

Dealer Reported	07/29/2014	66071		FAILURE - NECESSARY TO REPLACE LEFT FRONT TPMS SENSOR AND REPROGRAM SYSTEM,ALSO NECESSARY TO REPLACE RF TIRE DUE TO DAMAGE CAUSED BY LIFT.
Dealer Reported	05/08/2014	64629	002	STEERING WHL/MAIN SHAFT CUST STATES STEERING WHEEL NOT CENTERED AND VGRS AND VSC MESSEGE APPERA ON SCREEN - FOUND ELECTRIC STEERING GEAR INTERNAL FAILURE - NECESSARY TO REPLACE ELECTRIC STEERING GEAR ASSY AUTH# 2A \$3,845.17
Dealer Reported	05/08/2014	64629	002	HDLAMP RESTORATION PERFORM HEADLAMP RESTORATION. - HEADLAMP DETERIORATION. - PERFORM CLEANING AND RESTORATION OF HEADLAMPS.
Dealer Reported	05/08/2014	64629	002	STEERING WHL/MAIN SHAFT CUST STATES VSC LIGHT ON - FOUND RIGHT FRONT WHEEL SPEED SENSOR OPEN CIRCUIT - NECESSARY TO REPLACE FRONT RIGHT HUB BEARING ASSY AUTH# 1B \$635.32
Dealer Reported	05/08/2014	64629	002	DISTRIBUTOR/HDLIGHT/T. SGNL
Dealer Reported	04/25/2014	64555	001	MISC CUST STATES TRUNK WONT OPEN, INSPECT AND ADVISE EXT WARR - FOUND TRUNK LATCH LOCK CLOSER ASSY INTERNAL FAILURE - NECESSARY TO REPLACE TRUNK CLOSER ASSY COSTCO EXT WARRANTY AUTH# A \$738.04
Dealer Reported	04/25/2014	64555	001	CAR WASH COMPLEMENTARY CAR WASH
Dealer Reported	12/18/2013	62510	09	NON WARRANTABLE OPERATION CODE CUST STATES DRIP MOULDINGS COMING APART - FOUND ROOF DRIP MOULDINGS COMING APART - NECESSARY TO REPLACE DRIVER AND PASS SIDE DRIP MOULDING
Dealer Reported	12/18/2013	62510	09	NON WARRANTABLE OPERATION CODE PERFORM 4 WHEEL ALIGNMENT. - PERFORMED COMPLETE ALIGNMENT
Dealer Reported	12/18/2013	62510	09	NON WARRANTABLE OPERATION CODE CUST STATES OUTER DRIVER SIDE DOOR MIRROR WILL NOT FOLD INWARD - FOUND MIRROR INTERNAL MOTOR FAILURE - NECESSARY TO REPLACE DRIVWER SIDE DOOR MIRROR CENTURY WARR AUTH# \$823.50
Dealer Reported	12/18/2013	62510	09	FRONT AXLE CUST STATES NOISE FROM FT END OF VEHICLE WHEN GOING OVER BUMPS - FOUND LOWER CONTROL ARM BUSHINGS CRACKED AND CAUSING NOISE - NECESSARY TO REPLACE LOWER CONTROL ARMS ASSY CENTURY EXT WARRANTY AUTH# \$1775.92
Dealer Reported	10/08/2013	61778	09	MISC CUST STATES CD/DVD PLAYER INOP - FOUND CD DVD PLAYER INTERNAL FAILURE - NECESSARY TO REPLACE CD PLAYER UNIT OP#860031 LEXUS EXTRA CARE AUTH#VSAVG5080 NOTE ALL CD'S ;EFT INSIDE UNIT WILL BE MAILED BACK TO CUSTOMER ONCE DENSO ELECTRONICS HAS OPEN UNIT UP
Dealer Reported	10/08/2013	61778	09	NON WARRANTABLE OPERATION CODE CUST STATES AT TIMES AUTO TRUNK CLOSE INOP - PERFORMED COMPLETE INSPECTION AND WAS UNABLE TO DPULICATE CONCERN AT THIS TIME INTERIOR TRIM CUST STATES GARAGE

Dealer Reported	10/10/2012	55575	0776	OTHERS CUST STATES BRAKE MESSEGE CAME ON AND TRAC OFF AND LIGHTS CAME ON WHILE DRIVING - FOUND DTC CODES C1391 AND C1241 BRAKE ACTUATOR INTERNAL FAILURE - NECESSARY TO REPLACE BRAKE ACTUATOR TO CORRECT CONCERN LEXUS EXTRA CARE AUTH# 35 \$1946.59
Dealer Reported	10/10/2012	55575	077	INTERIOR TRIM CUST STATES LUMBAR ON FRONT DRIVER SIDE SEAT INOP - FOUND FRONT DRIVER SIDE LUMBAR ADJUSTER INTERNAL FAILURE - NECESSARY TO REPLACE DRIVER SIDE LUMBAR ADJUSTER LEXUS EXTRA CARE AUTH# \$1169.91
Dealer Reported	10/10/2012	55575	07	INTERIOR TRIM CUST STATES FAN BLOWER ON DRIVER AND PASS SIDE SEATS WILL NOT BLOW COOL - FOUND DRIVER AND PASS SIDE SEAT BLOWER MOTORS INTERNAL FAILURE - NECESSARY TO REPLACE BOTH SEAT BLOWER MOTORS LEXUS EXTRA CARE AUTH# 35 \$1089.12
Dealer Reported	10/10/2012	55575	0776	SPECIAL SERVICE CAMPAIGN CUST STATES AT TIMES TRANS SLIPS FROM A DEAD STOP - PERFORMED COMPLETE SCAN TEST AND FOUND NO CODES PRESENT OR HISTORY AT THIS TIME.PERFORMED ROAD TEST AND NO SLIPPING DETECTED AT THIS TIME.
Dealer Reported	10/10/2012	55575	0776	NON WARRANTABLE OPERATION CODE BUFF HEADLIGHTS AND LEXUS EMBLEM - COMPLETE
Dealer Reported	10/10/2012	55575	07	MISC CUST STATES DRIVER SIZE MEMORY SEAT INOP - NECESSARY TO RESET MEMORY ECU TO SEATS
Dealer Reported	05/18/2012	53230	07	NON WARRANTABLE OPERATION CODE CUST REQUEST HEADLAMP BUFFING AND FRT EMBLEM PLZ CK AND ADVISE - PERFORMED HEADLAMP DETAIL AND EMBLEM
Dealer Reported	05/18/2012	53230	07	ACCESSORY CUST STATE VEH DVD ISNT COMING ON WHEN PUT INTO PARKING PLZ CK AND ADVISE - NPF - TECH ADVISED THAT ""AUTO PARKING BRAKE"" MUST BE ON FOR FRT DISPLAY TO OPERATE
Dealer Reported	05/18/2012	53229	072	BUFF OUT HEADLIGHTS REF:727458 - PERFORMED DETAIL
Dealer Reported	05/16/2012	53168	072	OTHERS CUSTOMER STATES THERE IS A SHATTERING NOISE COMING FROM BRAKES. PLEASE CHECK. AND BRAKE PAD WEAR MESSEGE ON - FOUND CHATTER AND VIBRATION COMING FROM REAR PADS AND FRONT PADS WORN BELOW FACTORY SPECS - NECESSARY TO REPLACE FRONT AND REAR BRAKE PADS AND SENSORS AND RESURFACE ALL ROTORS TO CORRECT CONCERN
Dealer Reported	05/16/2012	53168	072	NON WARRANTABLE OPERATION CODE CUST STATES AT TIMES DOME LIGHT ON PASS SIDE WILL NOT COME ON WHEN FRONT PASS SIDE DOOR IS OPENED - FOUND FRONT PASS SIDE DOOR SWITCH INTERNAL OPEN SHORT - NECESSARY TO REPLACE SWITCH OP#832 LEXUS EXTRA CARE AUTH# 8 \$37.68
Dealer Reported	07/26/2011	46227	05	INSPECT BATTERY CHARGE LEVEL CUST STATES ENGINE NO CRANK - NECESSARY TO REPLACE BATTERY SPECIAL SERVICE CAMPAIGN CUST

Dealer Reported	10/08/2013	61778	093	DOOR OPENER DOESNT WORK UNLESS VISOR IS AIMED RIGHT AT IT - PERFORMED SIGNAL TEST TO ALL AUX BUTTONS AND FREQUENCY IS STRONG ON PORTS AT THIS TIME.
Dealer Reported	04/22/2013	59383	085	SEE SECTION CUSTOMER STATES A/C DOESNT TURN ON RIGHT AWAY, AFTER TURNING ON VEH, AND SYSTEM RESETS BACK TO 75 DEGREES, CHECK AND ADVISE. - FOUND DAMPER ASSY GETTING SUCK CAUSING A/C TO RESET IT SELF TO 75 DEGREES AND NOT TURN ON RIGHT AWAY, - REPLACED A/C DAMPER ASSY. LEXUS EXTRA CARE AUTH#
Dealer Reported	04/22/2013	59383	08	NON WARRANTABLE OPERATION CODE CUSTOMER REQUESTS TO HAVE ESTIMATE ON LEATHER REPAIR ON BACK PART OF PASSANGERS FRONT SEAT. - REPAIR AS PER EST.
Dealer Reported	04/22/2013	59383	085	MISC CUSTOMER TRUNK CLOSE SWITCH IS INOP AT TIMES, AT TIMES IT WLL START CLOSING AND THEN OPEN AGAIN, CHECK AND ADVISE. - UNABLE TO DUPLICATE PROBLEM, AT THIS TIME,
Dealer Reported	04/22/2013	59383	085	ACCESSORY CUSTOMER STATES NAVI SCREEN KEEPS GETTING DIMER, CHECK AND ADVISE. - UNABLE TO DUCPLICATE PROBLEM AT THIS TIME.
Dealer Reported	04/22/2013	59383	08	30000 MILE SERVICE NON WARRANTY 60000 MILE SERVICE - SCHEDULED MAINTENANCE DUE TO TIME OR MILEAGE - 60000 MILE SERVICE REPLACE ENGINE OIL AND FILTER, RESET MAINT REMINDER REPLACE ENGINE AIR FILTER INSPECT SPARK PLUGS REPLACE BRAKE FLUID INSPECT BRAKE PADS, LININGS, DISCS/DRUMS INSPECT STEERING LINKAGE,BALL JOINTS AND DUST COVERS INSPECT BODY/CHASSIS NUT
Dealer Reported	04/22/2013	59383	085	SPECIAL SERVICE CAMPAIGN CUSTOMER STATES VEH MAKES A BANG ON FIRST GEAR WHEN TAKING OFF FROM A COMPLETE STOP. CHECK AND ADVISE. - CONFIRMED CUSTOMER CONCERN - PERFORMED TCM REFLASH, LEXUS EXTRA CARE AUTH#
Dealer Reported	04/22/2013	59383	08	RADIATORFAN - CUSTOMER STATES VEH IS LEAKING WATER. CHECK AND ADVISE. - FOUND VEH LEAKING COOLANT FROM RADIATOR ASSY, - REPLACED RADIATOR TO CORRECT PROBLEM, LEXUS EXTRA CARE AUTH#
Dealer Reported	04/22/2013	59383	08	SEE SECTION CUSTOMER STATES PASSANGERS SIDE FRONT SEAT AND DRIVERS SIDE FRONT SEAT A/C DOESNT COOL SUFFICIENT, CHECK AND ADVISE. - FOUND HIGH RESISTANCE IN FANS, - REPLACED BOTH DRIVERS AND PASSANGERS SIDE FAN ASSY TO CORRECT PROBLEM PARTS WARRANTY ON RO ON 10/05/12
Dealer Reported	04/22/2013	59383	08	BATTERY/COIL SPK PLUG WHILE PERFORMING SERVICE BATTERY FAILED LOAD TEST AND WOULD NOT HOLD CHARGE, BATTERY HAS BAD CELL. - BATTERY FAILED LOAD TEST AND WOULD NOT HOLD CHARGE INTERNAL DAMAGE BAD CELL. - REPLACED BATTERY TO CORRECT PROBLEM. OPCODE#190011A PARTS WARRANTY RO #5 ON 07/26/11 MILEAGE AT TIME

Dealer Reported	10/23/2009	32242	029	OTHERS CUST STATES AT HIGHWAY SPEEDS OF 70MPH AND UP BRAKE PEDAL VIBRATES WHEN APPLIED. - FOUND VIBRATIOB FROM FRONT BRAKE PADS AND SENSORS WORN BELOW FACTORY SPLCS. - NECESSARY TO REPLACE FRONT BRAKE PADS AND RESURFACE FRONT ROTORS TO CORRECT CONCERN.
Dealer Reported	10/23/2009	32242	02	WHEEL/TIRE CONCERN CUST STATES STEERING WHEEL VIBRATES AT SPEEDS OF 65MPH AND UP - FOUND ALL WHEELS AND TIRES OUT OF BALANCE,NECESSARTY TO PERFORM REBLANCE TO CORRECT CONCERN
Dealer Reported	10/15/2009	30755	042	INSPECT TIRE PRESSURE CUSTOMER STATES THERE IS A VIBRATION AT HWY SPEEDS IN STEERING WHEEL. - ROAD FORCED ALL 4 TIRES AND BALANCED FOUR TIRES
Dealer Reported	10/12/2009	30755	042	NONOEM AUDIO CHANGEOUT - CUSTOMER STATES REAR SPEAKER RATTLING, CHECK AND ADVIS - REAR CENTER SUBWOOFER SPEAKER CONE SEPERATED FROM SPEAKER HOUSING - REPLACE REAR CENTER SPEAKER
Dealer Reported	10/05/2009	29896	02	30000 MILE SERVICE NON WARRANTY CUSTOMER REQUESTS 30000 MILE SERVICE MINUS OIL CHANGE,CUST JUST HAD OIL CHANGE PERFORMED. AND NO WIPER BLADES - SCHEDULED MAINTENANCE DUE TO TIME OR MILEAGE - 30000 MILE SERVICE PERFORMED REPLACE ENGINE OIL AND FILTER, RESET MAINT REMINDER REPLACE WIPER INSERTS ROTATE AND BALANCE TIRES REPLACE ENGINE AIR FILTER INSPECT BRAKE PADS, LININGS, DISCS/DRUMS REPLACE BRAKE FLUID INSPECT STEERING LINKAGE, BALL JOINTS AN
Dealer Reported	10/05/2009	29896	0282	OTHERS CUST STATES VIBRATION FROM BRAKES WHEN APPLIED. - PERFORMED REAR BRAKE ROTOR REUSRFACE TO CORRECT PULSATION FROM BRAKES WHEN APPLIED
Dealer Reported	10/05/2009	29896	02	STEERING WHL/MAIN SHAFT CUST STATES VEHICLE PULLING TO RIGHT - FOUND VEHICLE PULLING TO RIGHT. - NECESSARY TO PERFORM TSIB L - SB - 0035 - 08 COMBO A - H GOODWILL AS PER
Dealer Reported	10/05/2009	29896	028	MISC CUST STATES POPPING NOISE FROM REAR SPEAKER AND ONE FRONT SPEAKR,ADVISE - PERFORMED CD AUDIO TEST WITH LEXUS APPROVED AUDIO CD AND FOUND NO POPPING NOISE AT THIS TIME.POSSIBLE BAD RECORDING FROM HARD DRIVE.
Dealer Reported	10/05/2009	29896	0282	STEERING WHL/MAIN SHAFT CUST STATES VEH PULLING TO RIGHT ROAD TESTD VEHICLE AND FOUND VEHICLE DRIFITING TO RIGHT - PUT VEHICLE ON ALIGNEMNT MACHINE AND FOUND LEFT REAR TOE OUT OF SPEC. - NECESSARY TO PERFORM ALIGNMENT TO CORRECT TOE,ALSO FOUND TIRE PATTERN ON VEH TO CAUSE DRIFT TO RIGHT.UNABLE TO CORRECT DRIFT UNLESS TIRES ARE REPLACD.
Dealer Reported	06/17/2009	27817	0239	NON WARRANTABLE OPERATION CODE CUSTS TATES FRONT DRIVER SIDE SEAT BELT GETS STUCK COMING OUT - PERFORMED SEAT BELT TENSIONOR

Dealer Reported	01/18/2011	41848	047	STATES TRANS SLIPPING AND RPMS GO HIGH THEN TRANS CATCHES ESPECIALLY ON NORMAL ACCELERATION. - PERFORMED COMPLETE SCAN TEST TO TRANSMISSION AND FOUN ALL SHIFT POINTS TO FACTORY SPECS AT THIS POINT
Dealer Reported	01/18/2011	41848	047	WINDSHIELD WIPER/WASHER INSTALL WIPER BLADE INSERTS - UNABLE TO DUPLICATE AT THIS TIME
Dealer Reported	10/29/2010	38346	0440	LS & GS VALVE SPRING PERFORM ALE SPECIAL SERVICE CAMPAIGN LS 460, LS 600H, GS 460 VALVE SPRING REPLACEMENT. - ON CERTAIN VEHICLES THERE IS A POSSIBILITY THAT THE ENGINE VALVE SPRINGS MAY DEVELOP A CRACK AND BREAK. - SERVICE CAMPAIGN COMPLETED ENGINE VALVE SPRINGS REPLACED.
Dealer Reported	10/29/2010	38346	04	NON WARRANTABLE OPERATION CODE CUST STATES REAR PASS SIDE WINDOW MOULDING COMING APART - FOUND REAR MOULDING TRIM WARPED - NECESSARY TO REPLACE MOULDING OP#
Dealer Reported	10/29/2010	38346	04	NON WARRANTABLE OPERATION CODE CUST STATES FROTN DRIVER SIDE PILAR POST TRIM COVER PANEL COMING APART - FOUND FRONT DRIVER SIE PILAR POST TRIM COVER MATERIAL COMING APART - NECESSARY TO REPLACE TRIM PANEL OP# 7
Dealer Reported	10/29/2010	38346	044	INTERIOR TRIM CUST STATES REAR CENTER CONSOLE CUP HOLDER WILL NOT HOLD DRINKS - FOUND REAR CENTER CONSOLE CUP HOLDER ASSY COMING APART - NECESSARY TO REAR CENTER CONSOLE CUP HOLDER ASSY OP#
Dealer Reported	10/29/2010	38346	044	INTERIOR TRIM B PILAR ON DRIVER SIDE IS PEALING - FOUND DRIVER SIDE PILAR POST TRIM COMING APAT - NECESSARY TO REPLACE PILAR POST RIM PANEL OP#
Dealer Reported	10/29/2010	38346	044	INTERIOR TRIM CUST STATES ROOF PILAR TRIM COMING APART - FOUND ROOF PILAR TRIM MOULDING CLIPS COMING APART - NECESSARY TO REPLACE TRIM MOULDING CLIPS TO CORRECT CONCERN OP#
Dealer Reported	10/29/2010	38346	044	WATER PUMP CUST STATES VEHICLE LEAKING COOLANT - FOUND COOLANT LEAKING FROM WATER PUMP ASSY - NECESSARY TO REPLACE WATER PUMP ASSY TO CORRECT CONCERN OP#.
Dealer Reported	09/20/2010	37983	0429	NON WARRANTABLE OPERATION CODE CUST STATES OUTER TRUNK DOOR HANDLE MELTED - FOUND OUTER TRUNK LID MELTED - NECESSARY TO REPLACE OUTER TRUNK HANDLE OP#
Dealer Reported	09/20/2010	37983	047	DISTRIBUTOR/HDLIGHT/T. SGNL DRIVERS SIDE HEADLAMP KEEPS GOING ON AND OFF.LL - FOUND DRIVER SIDE HEADLAMP BULB INTERMITTANTLY OPEN CIRCUIT - NECESSARY TO REPLACE DRIVER SIDE BULB
Dealer Reported	05/10/2010	35678	0	DISTRIBUTOR/HDLIGHT/T. SGNL CUST STATES PASS SIDE HEADLAMP BULB TURNS OFF BY ITSLEF. - HEADLIGHT LIGHTBULB BURNT 810151 - REPLACED LIGHT BULB ASSY

Dealer Reported	06/17/2009	27817	023	TEST AND FOUND SEAT BELT TO BE WORKING TO FACTORY SPCS AT THIS TIME.NOTE THAT VEHICLE - MUST BE STANDING STILL AND PERFECTLY LEVEL OR ELSE SENSOR WILL LOCK SEAT BELT RACHETT SYSTEM.
Dealer Reported	04/29/2009	26981	022	INSPECT BATTERY CHARGE LEVEL - FOUND BATTERY NOT HOLDING CHARGE FAIL CODE A87P - NECESSARY TO REPLACE BATTERY TO CORRECT CONCERN OP#
Dealer Reported	04/28/2009	26981	022	NON WARRANTABLE OPERATION CODE CUST STATES AT TIMES DRIVER SIDE DOOR WILL NOT UNLOCK OR LOCK WITH REMOTE OR MANUALLY. INSTALL S.O.P ACTUATOR - FOUND FRONT DRIVER SIDE DOOR LOCK ACTUATOR INTERNAL FAILURE. - NECESSARY TO REPLACE FRONT DRIVER SIDE DOOR LOCK ACTUATOR TO CORRECT CONCERN OP#
Dealer Reported	04/24/2009	26893	022	INTERIOR TRIM CUST STATES AT TIMES VEHICLE WILL NOT START UNLESS PUSH BUTTON IS PRESSED SEVERAL TIMES THEN ONCE IT STARTS ENGINE - STALLS THERN HAS TO BE RESTARTED AGAIN. FOUND PUSH BUTTON STARTER BUTTON INTERMITTANTLY OPEN CIRCUIT - NECESSARY TO REPLACE START BUTTON TO CORRECT CONCERN OP#
Dealer Reported	04/13/2009	26760	02	FUEL DELIVERY PIPES SPECIAL SERVICE CAMPAIGN 9LA FUEL DELIVERY PIPE REPLACEMENT. - CORROSION ON INTERNAL SURFACE OF FUEL RAIL. - REPLACE FUEL RAILS ASSEMBLIES.
Dealer Reported	04/13/2009	26760	02	OTHERS CUST STATES CAR HARD TO START AT TIMES AND WHEN DOES START IT WILL TURN OFF ON ITS OWN BUTTOM MUST BE PRESSED SEVERAL TIMES BEFORE VEH TRYS TO START THEN WHEN IT DOES START ENGINE TURNS OFF BY ITSELF - UNBALE TO DUPLICATE AT THSI TIME,PEROFMRD INSPECTION AND FOUND ALL COMPONANS WORKING TO FACTORY SPECS.
Dealer Reported	04/13/2009	26760	021	NON WARRANTABLE OPERATION CODE CUST STATES AT TIMES KEYLESS REMOTE WILL NOT LOCK OR EVEN BEEP. - REPROGRAMMED BODY CONTROL MODULE.
Dealer Reported	04/18/2008	17973	00	OTHERS CK BRAKES AND ROTORS - TECH FOUND PULSENTION IN FRONT ROTORS - RESURFACE FRONT ROTORS SERVICE COMPLETED
Dealer Reported	04/18/2008	17973	007	WHEEL ALIGNMENT RECOMMEND ALIGHTMENT - TIRE WEAR FRONT INSIDE CUSTOMER WAS RECOMENDED TO REPLACE 4 TIRES CUSTOMER DECLINE SERVICE AT THIS TIME. - PERFORMED 4WHEEL ALIGHTMENT SERVICE COMPLETED
Dealer Reported	04/18/2008	17973	007	MISC ALL ELECTRICAL SHUTS DOWN AT TIMES - A/C, DASH, ECT... - UNABLE TO DUPLICATED CUSTOMER CONCERN AT THIS TIME - NO SERVICE DONE ON VEHICLE
Dealer Reported	10/17/2007	10998	095	FRONT/REAR BODY C/S THAT TRUNK WILL NOT OPEN /// - TSIB EL012 - 07 NEW LUGGAGE , ROOM JUNCTION BLOCK - R&R LUGGAGE ROOM JUNCTION BLOCK

Dealer Reported	10/11/2007	10959		FRONT/REAR BODY C/S THAT TRUNK WILL NOT OPEN BY INSIDE OR REMOTE /// - REPLACEMENT PARTS ARE NOT IN STOCK - PARTS HAVE BEEN SPECIAL ORDERED
Dealer Reported	06/21/2007	7665	020	NON WARRANTABLE OPERATION CODE CUST REQUESTS LOF SPECIAL SYNTHETIC OIL ONLY - PERFORMED LOF SPECIAL
Dealer Reported	06/21/2007	7665	020	NON WARRANTABLE OPERATION CODE HUM COMING FROM ELECTRICAL SYSTEM FROM INSIDE ON R/SIDE - VEHICLE OPERATING NORMALLY AT THIS TIME
Dealer Reported	06/21/2007	7665	020	NON WARRANTABLE OPERATION CODE CUST REQUESTS TIRE BALANCE - ROTATION - PERFORMED TIRE ROTATION - BALANCE
Dealer Reported	06/21/2007	7665	020	ELECT/MODULATED AIR SUSPNSN AIRBAG SYSTEM DRIVER SEAT BELT WONT COME OUT AT TIMES - VEHICLE OPERATING AS DESIGNED AT THIS TIME
Dealer Reported	06/21/2007	665	020	NON WARRANTABLE OPERATION CODE GLOVEBOX DOOR NOT CLOSING PROPERLY - GLOVE BOX NOT CLOSING TIGHTLY - REPLACE GLOVE BOX DOOR
Dealer Reported	06/21/2007	665	020	NON WARRANTABLE OPERATION CODE GARAGE DOOR BUTTONS INOP TRIED VARIOUS TIMES WONT TAKE PROGRAM - CONTROL WONT TAKE PROGRAM - REPLACE TRANSMITTER ASSY
Dealer Reported	12/16/2006	1485	019	NON WARRANTABLE OPERATION CODE LOANER
Dealer Reported	12/16/2006	1485	019	NON WARRANTABLE OPERATION CODE PERMA PLATE
Dealer Reported	12/16/2006	1485	0192	NON WARRANTABLE OPERATION CODE CUST REQUEST TO REPROGRAM GARAGE OPENER.....ON 1 AND 3.....S EE . - INFORMATION #....1 - 806 555 5515
Dealer Reported	10/31/2006		0	PREDELIVERY SERVICE FOR USA ALL ALTITUDES - PDI ORANGE
Dealer Reported	10/31/2006		019	INTERNAL DETAIL NC PREP ORANGE

Information Accuracy

Information presented on this Web site is summarized and standardized from repair orders completed at the time of service and submitted by Lexus dealers. When reviewing a vehicle's service history, please note that all information is provided by the Lexus dealership that conducted the service and that dealer is solely responsible for the accuracy, completeness or authenticity of any information contained in this site. Lexus provides this site and all information and materials contained herein "as is" without warranty of any kind.

Any questions or concerns regarding this information should be addressed to the applicable Lexus dealer

CPO Owner Information

Dealer-reported service history records are linked to a vehicle's Vehicle Identification Number (VIN). All owner-reported service history records will be made available to the person who input the information on the site but will not be shared with future owners of the vehicle.

Owner-Reported Information and Privacy Terms

Lexus makes every effort to ensure the secure collection and transmission of sensitive user information using industry-accepted data collection and encryption methodologies. The information you provide is used by Lexus and its vendors and dealers to help improve the services we render. It is occasionally provided to Lexus dealers for their marketing use. Lexus will never sell your personally identifiable information to any other company. To learn more about our privacy policies and practices with respect to this Web site, please [click here](#).