

Instrument Panel (Dashboard) and Door Panels Sticky/Cracked

Service Category Vehicle Interior

Section Interior Panels/Trim

Market USA

Lexus Supports
ASE Certification 

Applicability

YEAR(S)	MODEL(S)	ADDITIONAL INFORMATION
2008 - 2014	IS F, LS600H	
2006 - 2013	IS250, IS350	
2010 - 2015	IS250C, IS350C	
2007 - 2013	LS460	

REVISION NOTICE

January 15, 2020 Rev1:

- The Warranty Information and Repair Procedure sections have been updated.
- Any previous printed versions of this bulletin should be discarded.

SUPERSESION NOTICE

The information contained in this bulletin supersedes Service Bulletin No. L-SB-0041-15.

- Applicability has been updated to exclude 2007 model year LS600h vehicles.
 - The Repair Procedure section has been updated.
- Service Bulletin No. L-SB-0041-15 is obsolete and any printed versions should be discarded.

Introduction

Some 2006 – 2015 model year Lexus vehicles may exhibit a condition where any of the following components become sticky and/or cracked.

- Dashboard/instrument panel
- Interior door trim panels (front and rear)
- IP Lower (No. 1)
- Center console box
- Center console RR
- Glove compartment

Follow the Repair Procedure in this bulletin to address this condition.

Instrument Panel (Dashboard) and Door Panels Sticky/Cracked

Production Change Information

This bulletin applies to vehicles produced **BEFORE** the Production Change Effective VINs shown below.

- 2010 – 2015 IS C vehicles produced **BEFORE** the Production Change Effective VINs shown below.
- 2006 – 2013 IS250/IS350 vehicles produced **BEFORE** the Production Change Effective VINs shown below.
- 2008 – 2014 IS F vehicles produced **BEFORE** the Production Change Effective VINs shown below.
- 2007 – 2012 LS460 vehicles produced **BEFORE** the Production Change Effective VINs shown below.
- 2008 – 2010 LS600h vehicles produced **BEFORE** the Production Change Effective VINs shown below.

Table 1. Dashboard and Door Panels

MODEL	PLANT	KEY FRAME CODE	ENGINE TYPE	PRODUCTION CHANGE EFFECTIVE VIN
IS C	TMK	GSE20	4GR-FSE	JTHFF2C2#F2533646
		GSE21	2GR-FSE	JTHFE2C2#F2511736
IS250	TMK	GSE20	4GR-FSE	JTHBF5C2#D2103197
		GSE25		JTHCF5C2#D2036074
	Tahara 3E	GSE20		JTHBF5C2#D5193684
		GSE25		JTHCF5C2#D5064017
IS350	TMK	GSE21	2GR-FSE	JTHBE5C2#A2017712
	Tahara 3E	GSE21		JTHBE5C2#D5032065
		GSE26		JTHCE5C2#D5003209
IS F		USE20	2UR-GSE	JTHBP5C2#E5011572
LS460	Tahara 3/1A	USF40	1UR-FSE	JTHBL5EF#C5113810
		USF41		JTHGL1EF#C5046794
		USF45		JTHCL5EF#C5015488
		USF46		JTHDL5EF#C5004825
LS600h		UVF46	2UR-FSE	JTHDU1EF#A5013225

Instrument Panel (Dashboard) and Door Panels Sticky/Cracked

Production Change Information (continued)

Table 2. Console Box and IP No. 1

MODEL	PLANT	KEY FRAME CODE	ENGINE TYPE	PRODUCTION CHANGE EFFECTIVE VIN
LS460	Tahara 3/1A	USF40	1UR-FSE	JTHBL5EF#D5124954
		USF41		JTHGL5EF#D5050828
		USF45		JTHCL5EF#D5019597
		USF46		JTHDL1EF#D5006108
LS600h		UVF46	2UR-FSE	JTHDU46F#85002883

Table 3. Glove Compartment

MODEL	PLANT	KEY FRAME CODE	ENGINE TYPE	PRODUCTION CHANGE EFFECTIVE VIN
LS460	Tahara 3/1A	USF40	1UR-FSE	JTHBL5EF#C5113810
		USF41		JTHGL1EF#C5046794
		USF45		JTHCL5EF#C5015488
		USF46		JTHDL5EF#C5004825
LS600h		UVF46	2UR-FSE	JTHDU46F#85002883

Table 4. Console Box RR

MODEL	PLANT	KEY FRAME CODE	ENGINE TYPE	PRODUCTION CHANGE EFFECTIVE VIN
LS460	Tahara 3/1A	USF40	1UR-FSE	JTHBL5EF#D5124954
		USF41		JTHGL5EF#D5050828
		USF45		JTHCL5EF#D5019597
		USF46		JTHDL1EF#D5006108
LS600h		UVF46	2UR-FSE	JTHDU1EF#E5017461