



**Technical Service
Information Bulletin**

April 30, 1999

Title:

DIAGNOSTIC TROUBLE CODE P0446

Models:

'99 RX 300

T S I B

REVISÉD
ENGINE
EG001-99

Introduction Under certain driving conditions, some 1999 Model Year RX 300s will exhibit a false M.I.L. "ON" DTC P0446. A Charcoal Canister Assembly has been developed to prevent this condition.

**Production
Change
Information**

MODEL	VIN RANGE	
	FROM	TO
RX300 (2WD)	JT6GF10U*X0016513	JT6GF10U*X0022258
RX300 (4WD)	JT6HF10U*X0032670	JT6HF10U*X0046157


“*” May be any number from 0 to 9 or an X.

**Parts
Information**

PREVIOUS PART NUMBER	CURRENT PART NUMBER	PART NAME
77740-48010	77740-48030	Charcoal Canister Assembly

**Repair
Procedure**

1. Verify that the Purge System is operating as specified in the Repair Manual.
2. Raise vehicle on lift to gain access to the Charcoal Canister and remove the Charcoal Canister Assembly.
3. Install new Charcoal Canister Assembly.
4. Verify that all Vacuum/Purge Lines are attached securely.
5. Install Clamps on Purge Lines as shown in Illustration.
6. After lowering vehicle, verify that the Gas Cap is on securely.

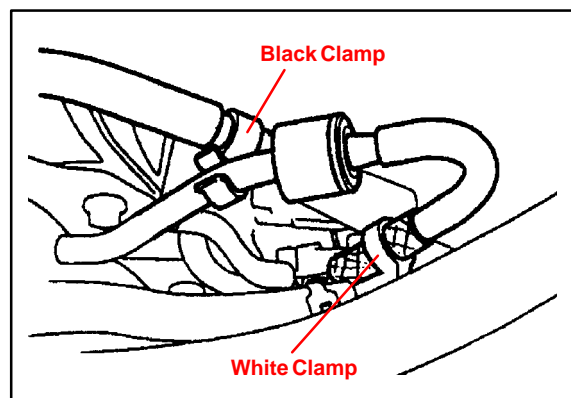

**Warranty
Information**

OP CODE	DESCRIPTION	TIME	OPN	T1	T2
8602L4	Charcoal Canister Assembly	0.5	77740-48030	99	99

Applicable Warranty*:

This repair is covered under the Lexus Basic Warranty. This warranty is in effect for 48 months or 50,000 miles, whichever occurs first, from the vehicle's in-service date.

* Warranty application is limited to correction of a problem based upon a customer's specific complaint.

NOTE:

Please enter the DTC P0446 in the Condition/Cause/Remedy Section when applying for Warranty Reimbursement.

