



# Technical Service Information Bulletin

June 18, 2004

Title:

## FRONT BRAKE VIBRATION

Models:

'04 RX 330

BR004-04  
BRAKES

**Introduction** Some customers may experience front brake vibration on 2004 model year RX 330 vehicles. New front brake rotors have been developed to improve this condition.

**Applicable Vehicles**

- **2004** model year **RX 330** vehicles produced **BEFORE** the Production Change Effective VINs shown below.

### Production Change Information

MODEL	PRODUCTION CHANGE EFFECTIVE VIN
RX 330	JTJGA31U#40032087 JTJHA31U#40060469 2T2GA31U#4C011300 2T2HA31U#4C017170

### Parts Information

PREVIOUS PART NUMBER	CURRENT PART NUMBER	PART NAME	QTY
43512-48081 (JPP)	Same	Disc, Front	2
43512-0E010 (NAP)	Same		2
04465-48100	Same	Front Brake Pad Kit	1 (if needed)
04945-0E010	Same	Shim Kit	1 (if needed)

### Repair Procedure

1. Confirm brake vibration is coming from front.
2. Inspect front brake pads and shims and replace if needed.
3. Refer to the Technical Information System (TIS) to remove and replace the front brake rotors following the procedures outlined in the 2004 model year RX 330 Repair Manual: *Brake: Front Brake: Overhaul*.
4. Road test vehicle.

### Warranty Information

OP CODE	DESCRIPTION	TIME	OFF	T1	T2
473011	R & R Front Brake Disc (One Side)	0.6	43512-48081 or 43512-0E010	9B	13
Combo A	Opposite Side	0.4			

#### Applicable Warranty\*:

This repair is covered under the Lexus Comprehensive Warranty. This warranty is in effect for 48 months or 50,000 miles, whichever occurs first, from the vehicle's in-service date.

\* Warranty application is limited to correction of a problem based upon a customer's specific complaint.

