



**Technical Service  
Information Bulletin**

June 6, 2007

Title:

# NOISE DURING HANDSFREE CALL

Models:

'07 RX 350/400h



**ELECTRICAL**  
**EL007-07**

**Introduction** Some customers may experience distortion on the receiving end of the call when using the "Handsfree" function. An improved microphone has been developed to correct this condition. Use the following repair procedure to remove and replace the microphone.

- Applicable Vehicles**
- 2007 model year **RX 350/400h** vehicles produced **BEFORE** the Production Change Effective VINs shown below.

**Production  
Change  
Information**

MODEL	PLANT	PRODUCTION CHANGE EFFECTIVE VIN
RX 350	TMMC	2T2GK31U58C035528
		2T2HK31U28C061976
	TMK	JTJGK31U780012277
		JTJHK31U582037350
RX 400h	TMK	JTJGW31U172004862
		JTJHW31U172031300

**Parts  
Information**

PREVIOUS PART NUMBER	CURRENT PART NUMBER	PART NAME	QTY
86290-48010	86290-50020	Amplifier Assembly, Microphone	1

**Warranty  
Information**

OP CODE	DESCRIPTION	TIME	OFF	T1	T2
EL7013	R & R Microphone Amplifier	0.4	86290-48010	76	71

**Applicable Warranty\*:**  
 This repair is covered under the Lexus Comprehensive Warranty. This warranty is in effect for 48 months or 50,000 miles, whichever occurs first, from the vehicle's in-service date.

\* Warranty application is limited to correction of a problem based upon a customer's specific complaint.

