L-TCI-3757	Rev.1	February 23, 2017	
------------	-------	-------------------	--



ECM Calibration: Hesitation Concerns

ServiceCategoryEngine/Hybrid SystemSectionEngine Control

Market Canada

APPLICABILITY:

YEAR(S)	MODEL(S)
2016 - 2017	RX350

REVISION NOTICE

April 5, 2017 Rev.1:

• The Warranty Information section has been updated.

Any previous printed versions of this bulletin should be discarded.

INTRODUCTION:

Some 2016 – 2017 model year RX 350 vehicles may exhibit a hesitation in one or more of the following conditions:

- Accelerating from a stop.
- Passing during freeway/city driving.
- Low speed reacceleration.

The Engine Control Module (ECM, SAE term: Powertrain Control Module/PCM) calibration has been revised to address these conditions.

PRODUCTION CHANGE INFORMATION:

This TSB applies to vehicles produced **BEFORE** the Production Change Effective VINs shown below.

WMI	DRIVETRAIN	TRIM	PRODUCTION CHANGE EFFECTIVE VIN
2T2		Non F Sport	2T2BZMCA#HC060399
	4WD	F Sport	2T2BZMCA#HC060921



ECM Calibration: Hesitation Concerns

WARRANTY INFORMATION:

OP CODE	DESCRIPTION	TIME	OFP	CLAIM TYPE	T1	T2
EE1702	Reprogram ECM (PCM) Engine	0.4	89661-0E760 89661-0E761 89661-0EA40 89661-0E810 89661-0E811 89661-0E770 89661-0E771 89661-48N70 89661-48N71	VE	04	99

APPLICABLE WARRANTY

- This repair is covered under the Lexus Major Emission Warranty. This warranty is in effect for 96 months or 130,000 kilometres, whichever occurs first, from the vehicle's in-service date.
- Warranty application is limited to occurrence of the specified condition described in this bulletin.

PARTS INFORMATION:

		TRIM	PART NUMBER			QTY
WMI	DRIVETRAIN	PREVIOUS NEW		PART NAME		
2T2	4WD	Non F Sport	89661-0E810 89661-0E811	89661-0E812	Computer, Engine	
212	400	F Sport	89661-0E770 89661-0E771	89661-0E772	Control (ECM/PCM)	-
-	-	-	00451-00001-25		Authorized Modification Labels	1

NOTE :

- The ECM (PCM) should NOT be replaced as part of the Repair Procedure.
- Authorized Modification Labels may be ordered in packages of 25 from your facing PDC.

L=XLIS L-TCI-3757 February 23, 2017 Rev.1

ECM Calibration: Hesitation Concerns

REQUIRED TOOLS & EQUIPMENT:

ITEM NO.	SPECIAL SERVICE TOOLS (SST)		MANUFACTURER	QTY
	Techstream/Techstream 2.0* Or		Snap-On	1
1	Techstream Lite** NOTE: Software version 11.30.137 or later is required.	°O'	Drew Technologies	1
2	GR8 Battery Diagnostic Station* p/n GR8C P		SPX/OTC	1

* Essential SST

** Refers to the Mongoose VIM in combination with a PC.

NOTE:

- The Diagnostic Tester (TDT) or Techstream LITE is NOT recommended for flash reprogramming with this calibration file.
- To order additional Techstream units, please go to TIS > Diagnostics > Scantool.
- Minimum PC requirements for Techstream Lite can be found on TIS > Diagnostics > Scantool > Techstream Reference Documents.
- The GR8 Battery Diagnostic Station (P/N GR8C P) supersedes the Hand Held Battery Tester (P/N J-44350) and Automatic Trickle Charger (P/N CXC 2815) which are are now obsolete.
- Additional SSTs may be ordered by calling Bosch Automotive Service Solutions at 1-800-933-8335.

CALIBRATION INFORMATION:

		TDIM	PART NUMBER		
WMI DRIVETRAIN		TRIM	PREVIOUS	NEW	
2T2 4WD	Non F Sport	896630E41000 896630E41100	896630E41200		
	F Sport	896630E37100 896630E37200	896630E37300		

L=XLIS L-TCI-3757
February 23, 2017
Rev.1

ECM Calibration: Hesitation Concerns

REPAIR PROCEDURE:

- 1. Does the vehicle exhibit standing start hesitation, passing hesitation during freeway/city driving and/or low speed area reacceleration hesitation?
 - YES Go to step 2.
 - NO This bulletin does NOT apply. Continue diagnosis using the applicable Repair Manual.
- 2. Check for the Authorized Modifications Label affixed to the vehicle in the location shown below. Confirm if the ECM (PCM) calibration has been updated.

Is the calibration ID listed NOT the latest ECM (PCM) calibration?

- YES Go to step 3.
- NO This Service Bulletin does NOT apply. Continue diagnosis using the applicable Repair Manual.

Figure 1. Location of Authorized Modification Label for 2016 – 2017 RX 350



ECM Calibration: Hesitation Concerns

REPAIR PROCEDURE (CONTINUED):

3. Flash reprogram the ECM (PCM).

NOTE

- The GR8 Battery Diagnostic Station MUST be used in Power Supply Mode to maintain battery voltage at 13.5 volts while flash reprogramming the vehicle.
- For details on how to use the GR8 Battery Diagnostic Station, refer to the GR8 Battery Diagnostic Station Instruction Manual located on TIS: Diagnostics > Tools & Equipment > Battery Diagnostics.

Follow the procedures outlined in TSB L-TCI-3746, "Techstream ECU Flash Reprogramming Procedure", and flash the ECM (PCM) with the NEW calibration file update.

4. Perform a 12V battery reset on the vehicle after software update.

NOTE

This step is important as certain options may become unavailable during software update.

- 5. Install the Authorized Modifications Label.
 - A. Using a permanent marker, enter the following information on the label:
 - ECM part number [Refer to the **Parts Information** section for the **NEW PART NUMBER]**
 - Calibration ID(s) [Refer to the Calibration Information chart for the NEW CALIBRATION ID]
 - Dealer Code
 - Repair Date
 - Change Authority [This TSB number]
 - B. Affix the Authorized Modifications Label to the vehicle at the location shown in Figure 1. The Authorized Modifications Label is available through your facing PDC, P/N 00451-00001-25.
- 6. Start the engine and warm it up to normal operating temperature and test drive to confirm proper vehicle operation.

NOTE:

Issue of this Technical Service Bulletin is to ensure that proper repair information is available. IT DOES NOT CONSTITUTE AN AUTHORIZATION FOR REPAIR. Normal provisions of the formal warranty policy, as applicable, will apply.