

Last Modified: 01-06-2021	6.10:8.0.50	Doc ID: RM100000000RDEX
Model Year Start: 2016	Model: RX350	Prod Date Range: [09/2015 -]
Title: 2GR-FKS (ENGINE CONTROL): ACCELERATOR PEDAL: REMOVAL; 2016 - 2021 MY RX350 [09/2015 -]		

REMOVAL

PROCEDURE

1. REMOVE FRONT DOOR SCUFF PLATE LH

Click here [INFO](#)

2. REMOVE COWL SIDE TRIM BOARD

Click here [INFO](#)

3. REMOVE NO. 1 INSTRUMENT PANEL UNDER COVER SUB-ASSEMBLY


Click here [INFO](#)

4. REMOVE ACCELERATOR PEDAL SENSOR ASSEMBLY

NOTICE:

- Avoid physical shock to the accelerator pedal sensor assembly.
- Do not disassemble the accelerator pedal sensor assembly.
- The accelerator pedal sensor assembly does not require lubrication.
- Do not apply oil or other lubricants to the accelerator pedal sensor assembly. If applied, the accelerator pedal sensor assembly must be replaced.

(a) Disconnect the accelerator pedal sensor assembly connector.

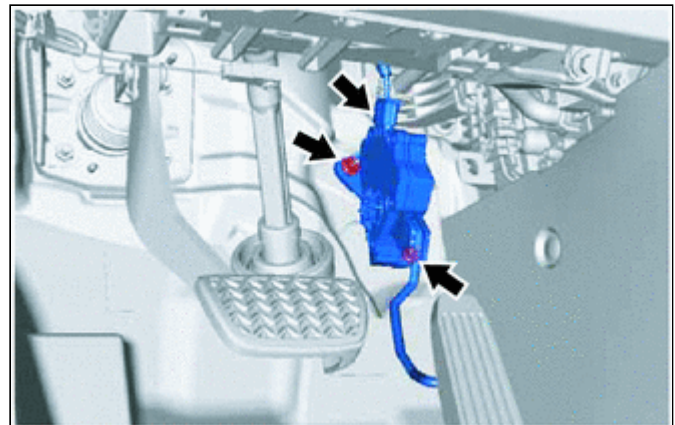

(b) Remove the 2 nuts and accelerator pedal sensor assembly.

NOTICE:


If the accelerator pedal sensor assembly has been struck or dropped, replace it.

(c) Separate the rod of the accelerator pedal sensor assembly from the accelerator pedal assembly to remove the accelerator pedal sensor assembly.

5. REMOVE ACCELERATOR PEDAL PAD

(a) Disengage the 2 claws and remove the accelerator

pedal pad.

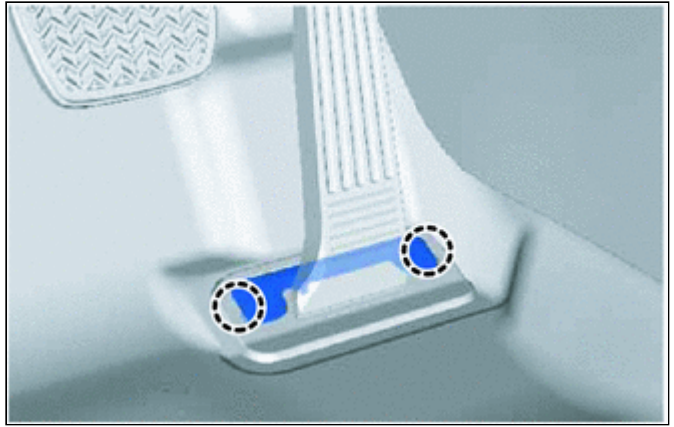

6. REMOVE ACCELERATOR PEDAL

(a) Remove the 2 bolts and accelerator pedal.

