

Front Suspension Support - Noise

SUSPENSION
SU002-99

December 10, 1999

Title:
FRONT SUSPENSION SUPPORT NOISE

Models
'97-'00 ES 300 & '99-'00 RX 300

Introduction


To eliminate a noise occurrence from the front suspension on washboard type road surfaces, the suspension support has been changed.

Applicable Vehicles

^ 1997 - 2000 Model Year ES 300 and 1999 - 2000 Model Year RX 300.

Production Change Information

The rubber bushing shape of the suspension support has been changed.

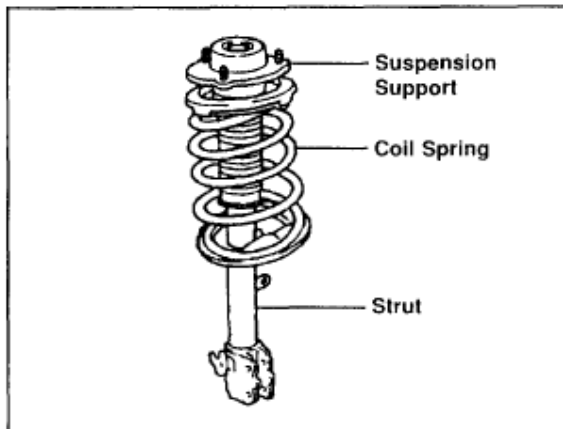

NOTE The rubber bushing shape of the suspension support has been changed.

MODEL STARTING VIN

JT8BF28G*Y0237725

ES 300 JT8BF28G*Y5075984

JT6GF10U*Y0045378

RX 300 JT6HF10U*Y0097408

| PREVIOUS PART NUMBER | CURRENT PART NUMBER | PART NAME | QUANTITY |
|----------------------|---------------------|--|----------|
| 48603-33020 | 48603-33021 | Support Sub-Assembly, Front Suspension RH | 1 |
| 48609-33120 | 48609-33121 | Support Sub-Assembly, Front Suspension LH | 1 |

Parts Information

Warranty Information

| OPCODE | COMBO | DESCRIPTION | TIME | OPN | T1 | T2 |
|--------|-------|---|------|-------------|----|----|
| 431451 | A | R & R Front Suspension Support Assembly (RH and LH) | 1.6 | 48603-33020 | 91 | 99 |
| | B | Adjust Toe-in | | | | |

ES 300

| OPCODE | COMBO | DESCRIPTION | TIME | OPN | T1 | T2 |
|--------|-------|---|------|-------------|----|----|
| 431451 | A | R & R Front Suspension Support Assembly (RH and LH) | 2.0 | 48603-33020 | 91 | 99 |
| | B | Adjust Toe-in | | | | |

RX 300

Applicable Warranty*:

This repair is covered under the Lexus Basic Warranty. This warranty is in effect for 48 months or 50,000 mi vehicle's in-service date.

* Warranty application is limited to correction of a problem based upon a customer's specific complaint.