

Last Modified: 7-13-2007		1.6 A
Service Category: Vehicle Exterior	Section: Exterior Panels/Trim	
Model Year: 2008	Model: ES350	Doc ID: RM000000MNH00GX
Title: EXTERIOR: ROOF DRIP SIDE FINISH MOULDING: REMOVAL (2008 ES350)		

REMOVAL

1. REMOVE ROOF DRIP SIDE FINISH MOULDING CENTER

HINT:


When removing the roof drip side finish moulding center, heat the body and roof drip side finish moulding center using a heat light.

Heating temperature:


ITEM	TEMPERATURE
Vehicle Body	40 to 60°C (104 to 140°F)
Moulding	20 to 30°C (68 to 86°F)

NOTICE:

Do not heat the vehicle body and moulding excessively.

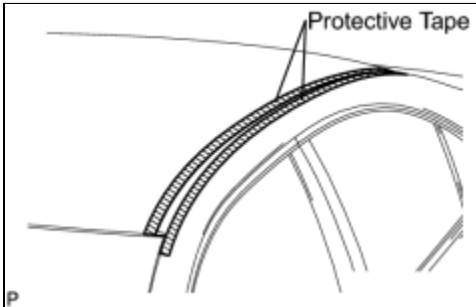

(a) Put protective tape around the roof drip side finish moulding center.

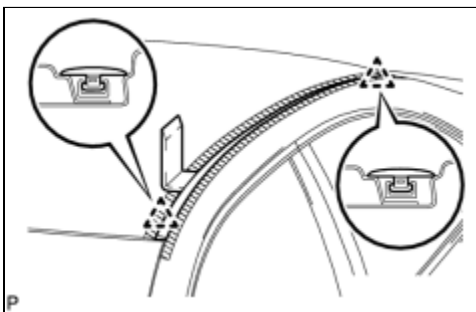


(b) Using a moulding remover, disengage the 2 clips.

NOTICE:

- Do not remove the clips.
- If the clips are damaged or dropped off, replace them with new ones.


(c) Peel off the double-sided tape and remove the roof drip side finish moulding center.

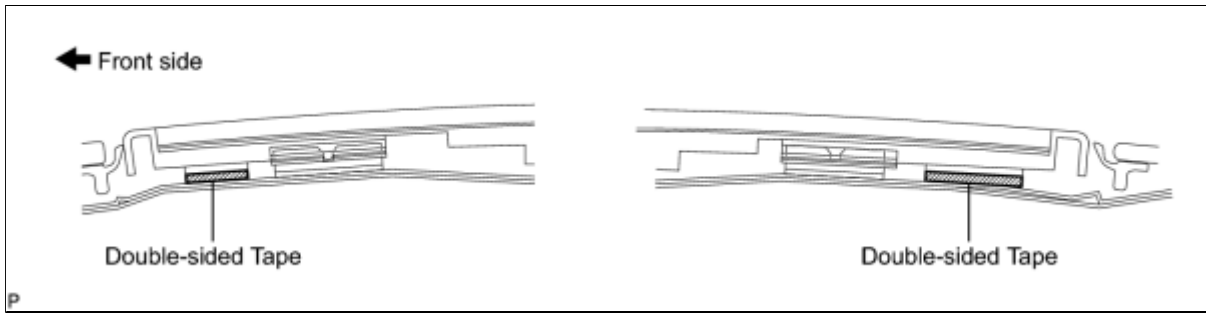

2. REMOVE ROOF DRIP SIDE FINISH MOULDING CLIP

HINT:

Perform the following procedure if replacing the roof drip side finish moulding clips.

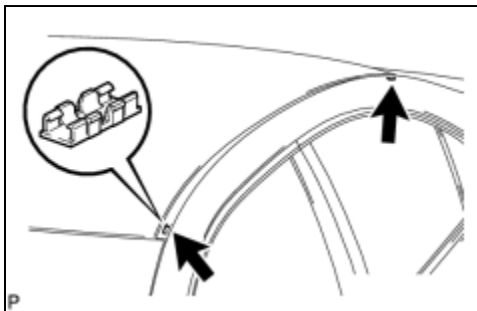

(a) Remove the 2 roof drip side finish moulding clips.

