
Last Modified: 7-13-2007		1.6 A	
Service Category: Audio/Visual/Telematics	Section: Audio/V	Section: Audio/Video	
Model Year: 2008	Model: ES350	Doc ID: RM000001PZJ008X	
Title: AUDIO / VISUAL: RADIO RECEIVER: REMOVAL (2008 ES350)			


### **REMOVAL**

- 1. REMOVE SHIFT LEVER KNOB SUB-ASSEMBLY
- 2. REMOVE UPPER CONSOLE PANEL ASSEMBLY WITH FRONT ASH RECEPTACLE
- 3. REMOVE INSTRUMENT PANEL FINISH PANEL END LH
- 4. REMOVE INSTRUMENT PANEL FINISH PANEL END RH
- 5. REMOVE NO. 2 INSTRUMENT PANEL REGISTER ASSEMBLY
- 6. REMOVE INTEGRATION CONTROL PANEL WITH RADIO RECEIVER ASSEMBLY (w/o Navigation System)

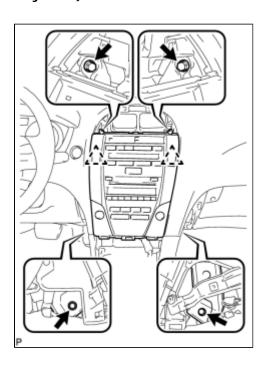


(a) Remove the 4 bolts.

- (b) Pull the integration control panel with radio receiver assembly toward the rear of the vehicle and disengage the 2 clips.
- (c) Disconnect each connector and remove the integration control panel with radio receiver assembly.
- 7. REMOVE NO. 1 RADIO BRACKET (w/o Navigation System)

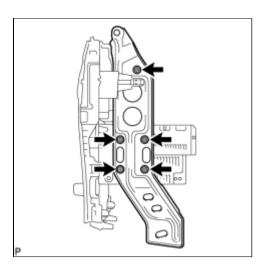


## 8. REMOVE NO. 2 RADIO BRACKET (w/o Navigation System)

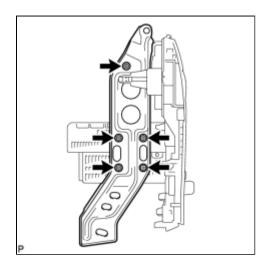

(a) Remove the 4 bolts, screw, and No. 2 radio bracket.


#### 9. REMOVE RADIO RECEIVER ASSEMBLY (w/o Navigation System)

(a) Disengage the 2 claws and 6 clips.

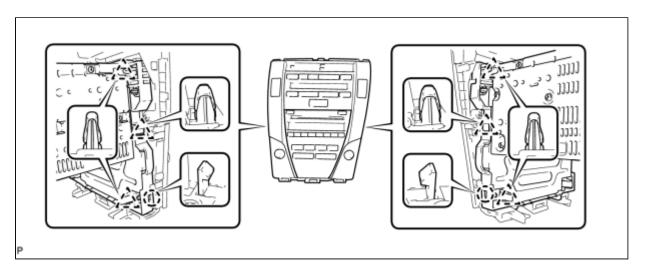

(b) Remove the radio receiver assembly.


# 10. REMOVE MULTI-DISPLAY WITH RADIO RECEIVER ASSEMBLY (w/ Navigation System)

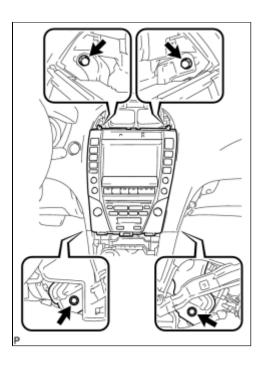

(a) Remove the 4 bolts.


- (b) Pull the multi-display with radio receiver assembly toward the rear of the vehicle and disengage the 2 clips.
- (c) Disconnect each connector and remove the multi-display with radio receiver assembly.

## 11. REMOVE NO. 1 RADIO BRACKET (w/ Navigation System)

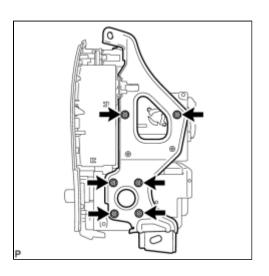

(a) Remove the 6 bolts and No. 1 radio bracket.


## 12. REMOVE NO. 2 RADIO BRACKET (w/ Navigation System)

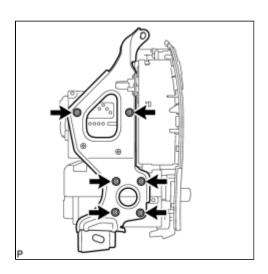

(a) Remove the 6 bolts and No. 2 radio bracket.

## 13. REMOVE RADIO RECEIVER ASSEMBLY (w/ Navigation System)

(a) Disengage the 2 claws and 4 clips.

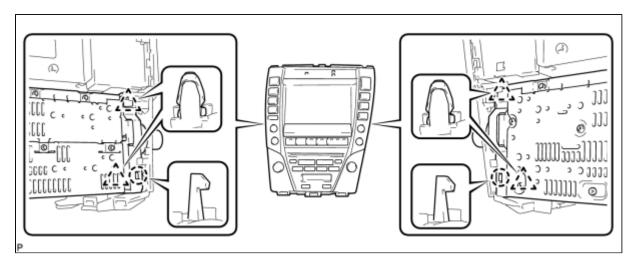

(b) Remove the radio receiver assembly.



