

<b>Last Modified:</b> 12-20-2022	6.11:8.1.0	<b>Doc ID:</b> RM1000000020IP4
<b>Model Year Start:</b> 2022	<b>Model:</b> NX250	<b>Prod Date Range:</b> [11/2021 - ]
<b>Title:</b> EXTERIOR PANELS / TRIM: WHEEL OPENING MOULDING (for Front Side): REMOVAL; 2022 - 2023 MY NX250 NX350 NX350H [11/2021 - ]		

## REMOVAL


### CAUTION / NOTICE / HINT

**HINT:**

- Use the same procedure for the RH side and LH side.
- The following procedure is for the LH side.

### CAUTION / NOTICE / HINT


#### COMPONENTS (REMOVAL)

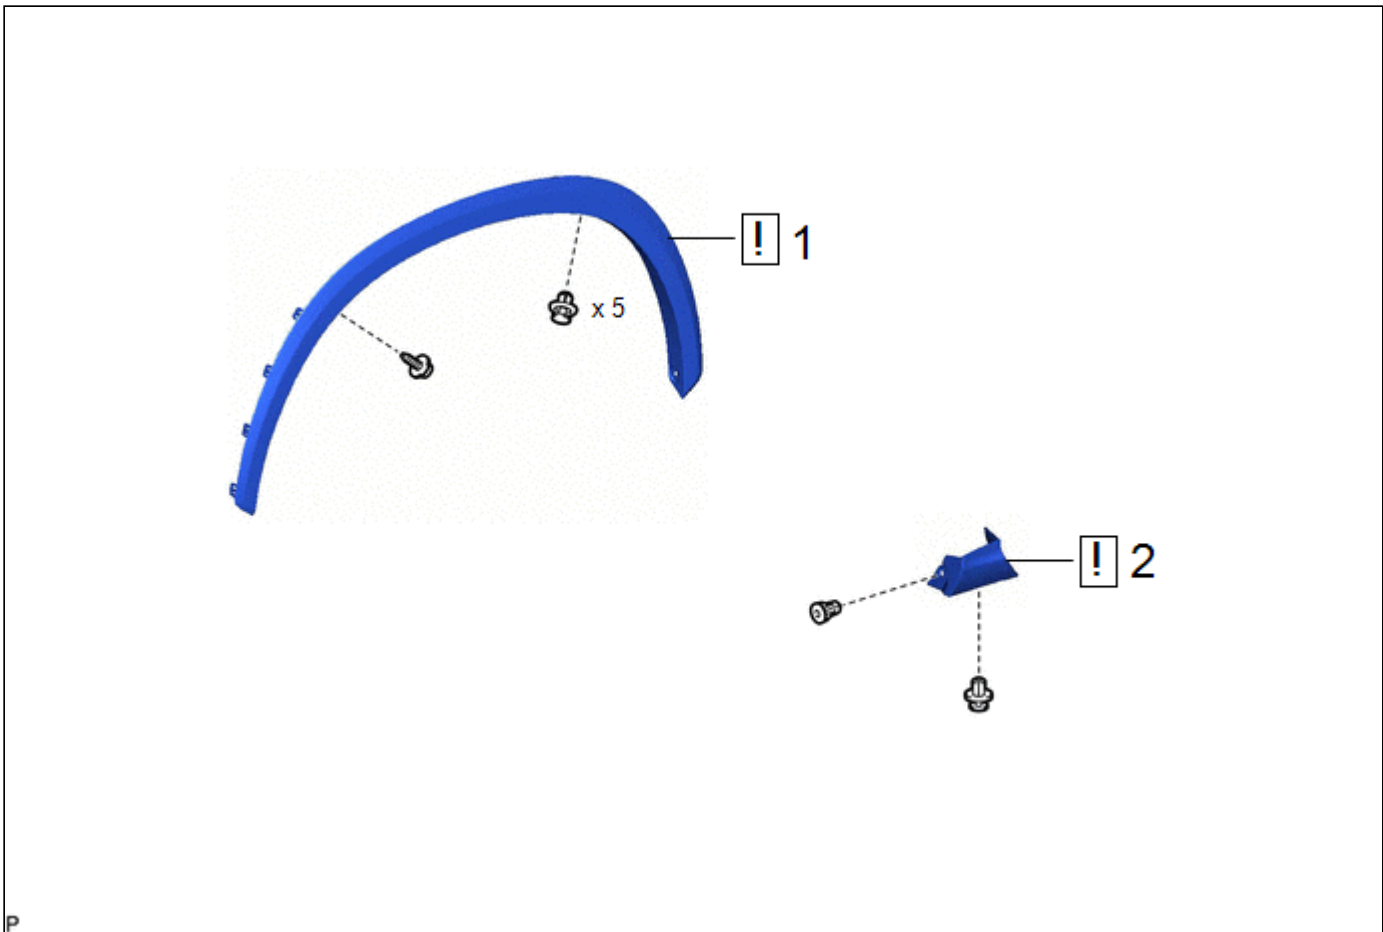




	PROCEDURE	PART NAME CODE			
1	FRONT FENDER MOULDING SUB-ASSEMBLY	75602A	<a href="#">INFO</a>	-	-
2	FENDER PANEL MUDGUARD SUB-ASSEMBLY	76902B	<a href="#">INFO</a>	-	-

# PROCEDURE
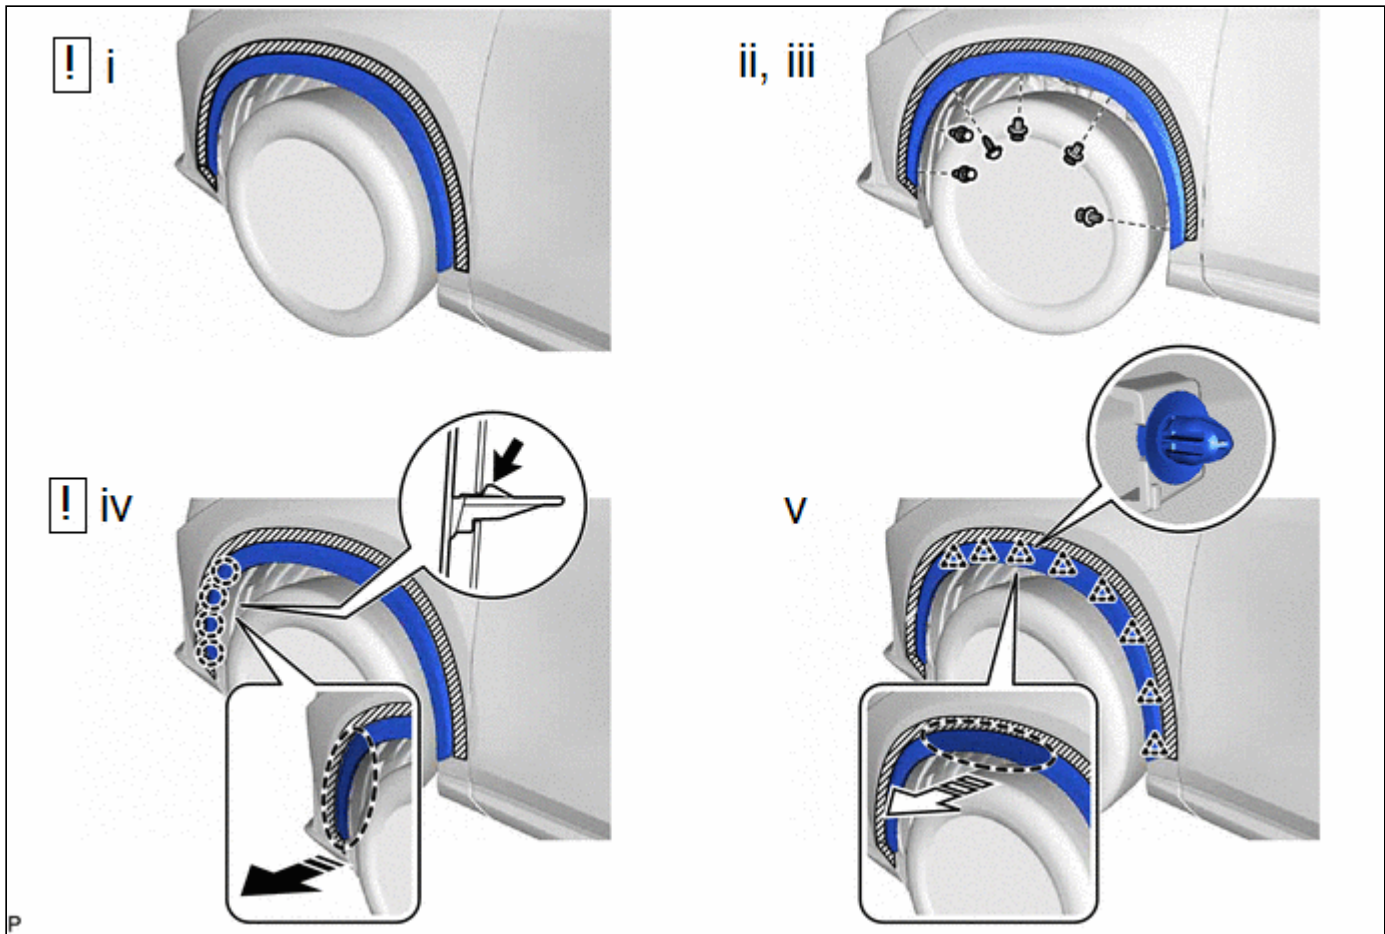
## 1. REMOVE FRONT FENDER MOULDING SUB-ASSEMBLY



	Place Hand Here	-	-
	Remove in this Direction (1)		Remove in this Direction (2)


- (1) Apply protective tape around the front fender moulding sub-assembly as shown in the illustration.
- (2) Using a 4 mm hexagon wrench, remove the screw.
- (3) Remove the 5 clips.
- (4) Pull back the edge of the front fender liner and disengage the 4 claws by pushing the area indicated by the arrow in the illustration with a finger.


**NOTICE:**

- Do not apply excessive force when pulling back the front fender liner.
- To avoid damaging the claws, do not forcibly pull the front fender moulding sub-assembly.

- (5) Disengage the 8 clips and separate the double-sided tape to remove the front fender moulding sub-assembly as shown in the illustration.

## 2. REMOVE FENDER PANEL MUDGUARD SUB-ASSEMBLY

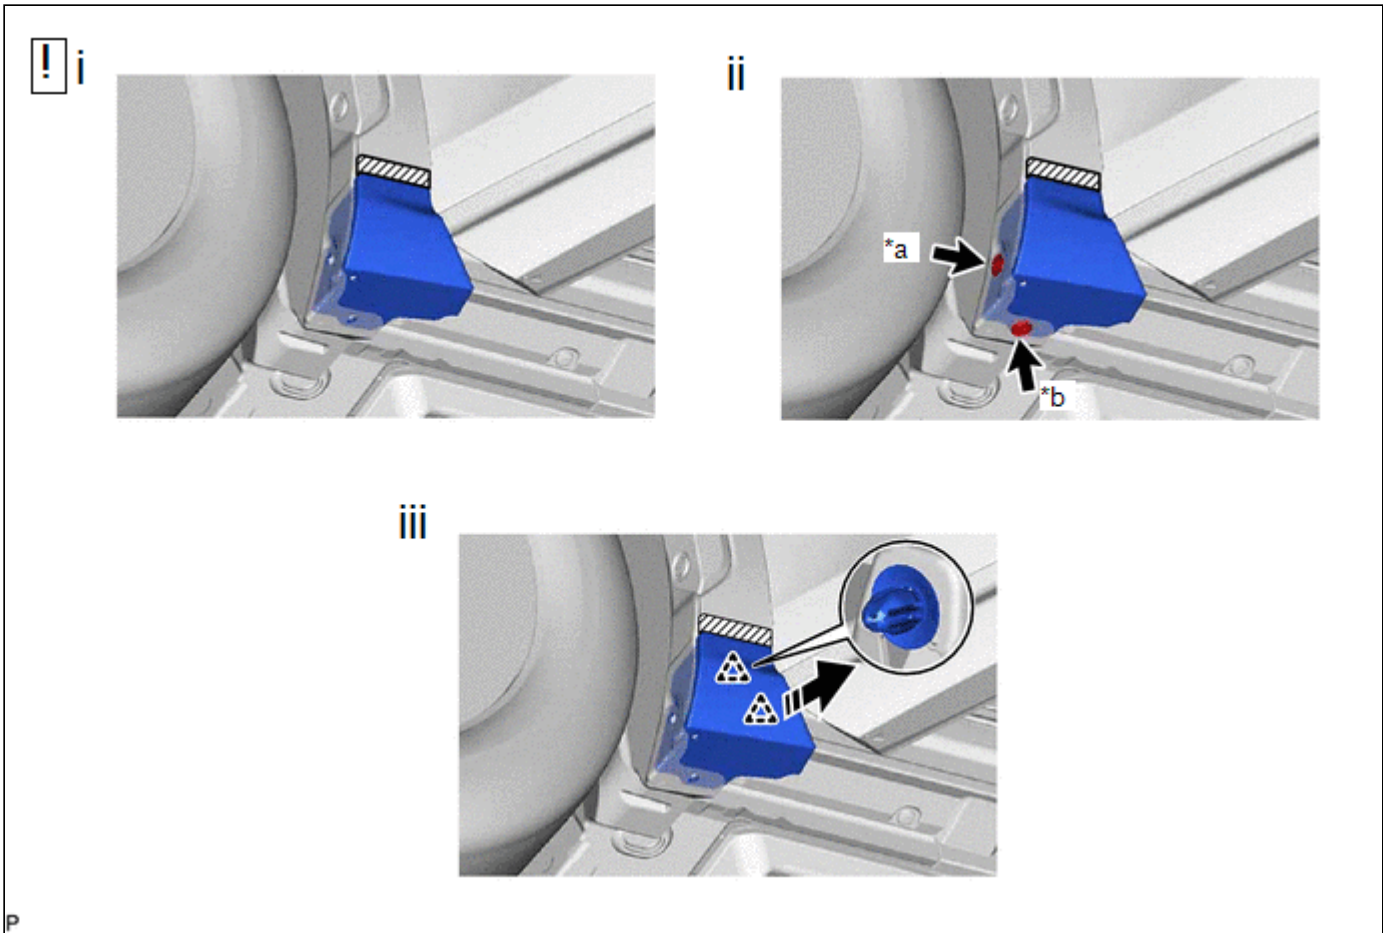

	Remove in this Direction	-	-
*a	Grommet	*b	Clip

- (1) Apply protective tape around the fender panel mudguard sub-assembly as shown in the illustration.
- (2) Remove the grommet and clip.
- (3) Disengage the 2 clips and remove the fender panel mudguard sub-assembly as shown in the illustration.

