

Last Modified: 7-13-2007		1.6 G
Service Category: Vehicle Exterior	Section: Horn	
Model Year: 2008	Model: ES350	Doc ID: RM0000016F7010X
Title: HORN: HORN RELAY: INSPECTION (2008 ES350)		

INSPECTION


1. INSPECT FUSE (HORN)

(a) Check the resistance of the HORN fuse.

Standard:
Below 1 Ω

2. INSPECT HORN RELAY

- (a) Remove the engine room R/B and J/B (horn relay).
(b) Measure the resistance according to the value(s) in the table below.

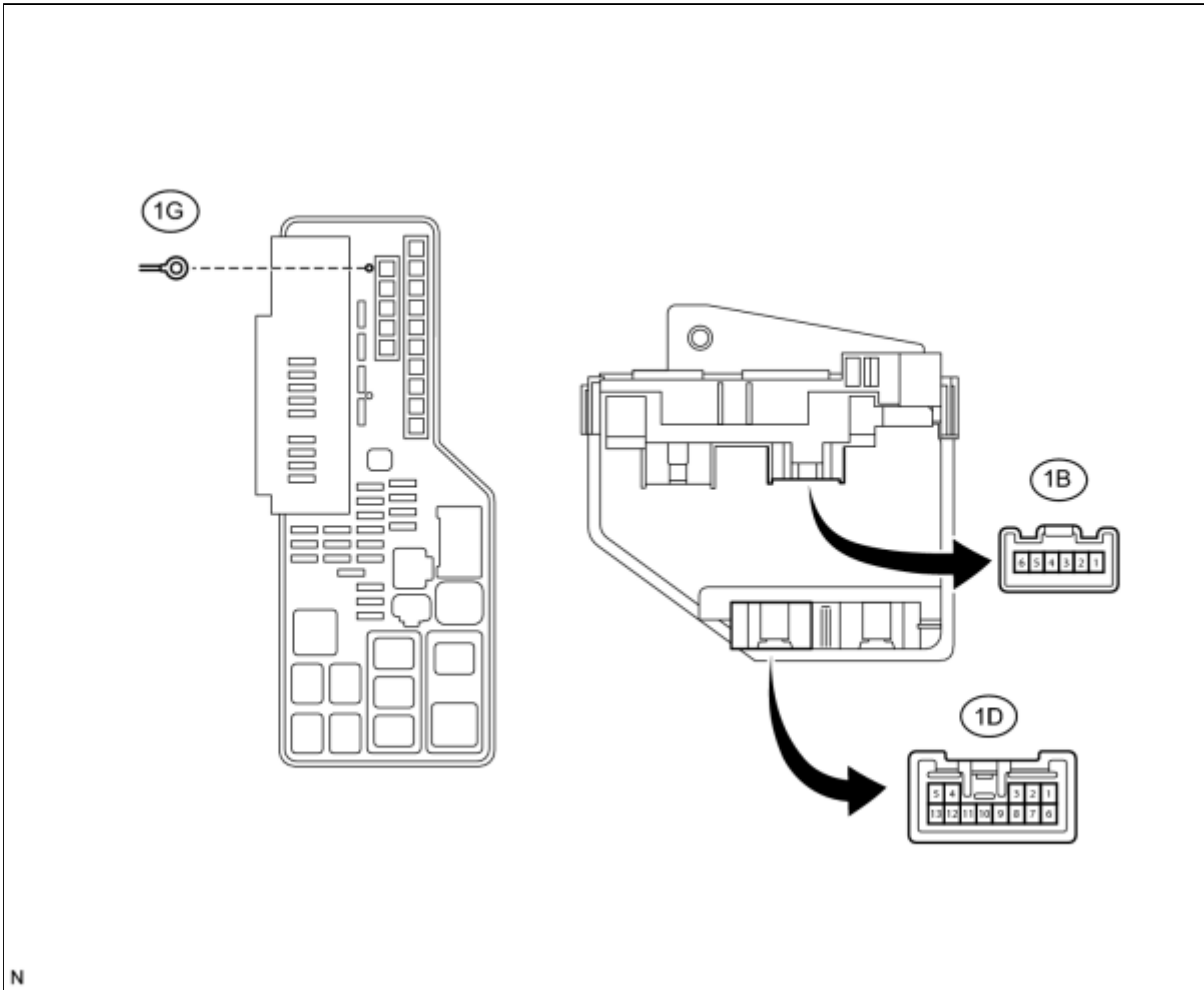

Standard resistance:

TESTER CONNECTION	CONDITION	SPECIFIED CONDITION
1G-1 - 1B-6	When battery voltage is not applied to terminals 1G-1 and 1D-10	10 k Ω or higher
1G-1 - 1B-6	When battery voltage is applied to terminals 1G-1 and 1D-10	Below 1 Ω

