

Last Modified: 7-13-2007		1.6 A
Service Category: Vehicle Exterior	Section: Mirror (ext)	
Model Year: 2008	Model: ES350	Doc ID: RM000001XT7009X
Title: MIRROR: OUTER MIRROR CONTROL ECU: REMOVAL (2008 ES350)		

REMOVAL

1. DISCONNECT CABLE FROM NEGATIVE BATTERY TERMINAL

CAUTION:

Wait for 90 seconds after disconnecting the cable to prevent airbag deployment [INFO](#) .

2. REMOVE INSTRUMENT PANEL FINISH PANEL END RH [INFO](#)

3. REMOVE FRONT DOOR SCUFF PLATE RH [INFO](#)

4. REMOVE FRONT DOOR OPENING TRIM COVER RH [INFO](#)


5. REMOVE NO. 2 INSTRUMENT PANEL UNDER COVER SUB-ASSEMBLY [INFO](#)

6. REMOVE SIDE INSTRUMENT PANEL RH [INFO](#)

7. REMOVE FRONT PASSENGER SIDE KNEE AIRBAG ASSEMBLY [INFO](#)

8. REMOVE LOWER INSTRUMENT PANEL RH [INFO](#)

9. REMOVE OUTER MIRROR CONTROL ECU ASSEMBLY

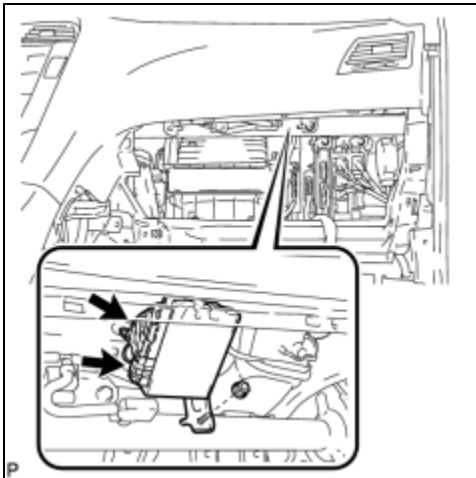

(a) Disconnect the 2 connectors.

(b) Remove the nut and the outer mirror control ECU assembly.

